



SISPM1040-384-LRT-C Release Notes

Date: Aug. 17, 2020

Version: 7.10.2629

Overview

This release notes covers firmware version v7.10.2629 and MIB file for SISPM1040-384-LRT-C

Release Changes and Enhancements

[New Features & Changes]

=====

- * Restful API support
- * Web GUI timeout setting
- * Add MRP Ring option in Trap Event Severity Configuration

[Bugs Fixed]

=====

- * API: Setting system info via API, but the setting is invalid and clear system information.
- * Reflash the WebUI, the Timeout setting will return to Startup Config setting.
- * Config: When VLAN 1 is disabled, the switch will be abnormal.
- * Timeout: When set timeout to 20 min, press another option in the menu after logging in for 12 min, the browser will go to login page.
- * Timeout: When set timeout to 20 min, open new tab after logging in 12 min, the page will go to login page.
- * CLI: Performing the "no hostname" command, the hostname does not restore to default.
- * Timeout: Set timeout as 1 min and save to startup config, the timeout behavior is not expected.
- * AAA: There is http redirect command in custom-config, when uploading the no http redirect command of custom-config, abnormal phenomenon will occur.
- * MRP: domain Events time stamp information is wrong.
- * Syslog: The first syslog sent by the switch is incorrect.
- * Web: After entering the First time wizard, without setting a password and closing the browser, connecting again will directly enter the system information.
- * 802.1X: Use Cisco ISE server, MAC-based Authentication will fail.

Known Limitations and Restrictions

- *API: copper spell cooper in return
- * API: the return of Device List Table is not parsed for each device.